

# Robert Morris School: Asbestos Hazard Report

The Philadelphia Regional Center for Children's Environmental Health has partnered with the Healthy Schools Initiative to analyze and report on public information regarding asbestos conditions in schools made available on the School District of Philadelphia's website.

This report is meant to communicate to parents, teachers, and staff the exposure risk at their school and help prioritize the removal of asbestos in high-risk exposure locations.

Our analysis is based on publicly available reports. We have not conducted inspections or verified the reports.

## Key Findings:

- 82 teacher / student occupied spaces have asbestos containing material (ACM)
- 3 spaces had damaged ACM
- 5 spaces contained friable ACM
- **2 of 3 damaged** materials were scheduled to be abated

## Our Recommendations:

- The School District scheduled the abatement for two of the three damaged ACM identified during their latest inspection in Jul 2025. The School District did not abate damaged non-friable asbestos-containing floor tile in the principal's office (see Table 2). We recommend this material be abated.



## What is asbestos?

**Asbestos is a fibrous material that is resistant to heat, water, and corrosion.**

See this link for a comprehensive list: <https://prcceh.upenn.edu/asbestos>

## Asbestos was used in materials in schools, including:

- Ceiling Tiles
- Floor Tiles
- Pipe Insulation
- Cement
- Paint and Caulk
- Soundproofing
- Fireproofing
- Plaster Materials

## What are the health effects of asbestos?

No immediate health impacts are expected from asbestos exposure in schools. However, breathing asbestos fibers in schools may increase the risk of developing cancer many years from now.

Children are very active, breathing more air while running and playing. Children take more breaths per minute than adults and are lower to the ground where asbestos fibers may settle. This puts them at an increased risk for asbestos exposure.

## Are all asbestos containing materials of equal risk?

Some asbestos containing materials like ceiling and floor tiles have asbestos fibers imbedded in other materials. As long as they are not broken or damaged the asbestos fibers are not released into the air.

Some asbestos containing materials like insulation on pipe remains fibrous and can easily be released in the air when damaged.

## How are damaged asbestos containing materials managed?

Asbestos can be removed. Sometimes damaged materials are managed in place by patching, encapsulating (using a specially formulated paint-like coating) or building an enclosure around damaged and/or accessible materials. All of these are forms of abatement.

The Environmental Protection Agency requires all remaining asbestos containing material to be inspected by the school district every six months. This is documented in an Asbestos Hazard Emergency Response Act Report (AHERA Report).

### Important Terms

*Get to know these terms to make the most out of this report.*

**Damaged Asbestos Containing Material (ACM)** can release asbestos fibers into the air.

**Friable Materials** can be reduced to a powder by applying hand pressure. **DO NOT TOUCH!**

**Non-Friable materials** are not easily damaged.

**Significantly damaged materials** are more than 10% damaged.

**Abated ACM** means repaired, removed, or reduced risk of exposure.

## Detailed Review for Robert Morris School

This school has 95 spaces with asbestos-containing materials. 82 of them are in teacher / student occupied spaces. The School District last inspected ACM in Jul 2025 and published the AHERA report in Aug 2025. Since the inspection, the School District has scheduled the abatement of two of three damaged asbestos-containing non-friable materials identified during this inspection.



The non-friable asbestos-containing floor tile found in the principal's office was identified as damaged in the inspection completed in Jan 2025 and was scheduled to be abated in Jul 2025 but was found to still be damaged in the Jul 2025 inspection. While this material is low-risk, we recommend that the school district schedule abatement for this material if it is, in fact, still damaged.

Abatement of two of the damaged materials was scheduled in 2025; however, the website does not confirm that the abatement was completed. A list of all the ACM in the school and their damage/abatement schedule can be found in the tables at the end of this report.

## Information Reviewed to Make this Report:

The 2024/25 AHERA report from the School District of Philadelphia, and asbestos abatement notifications from the Air Management Services Online Portal.

**Not included** in this report are planned repairs to damaged asbestos materials that have not been uploaded to the Air Management Services website or any updates after Sep 26, 2025. To see the most current information, scan these QR Codes. After scanning, search for your school.



Report what you see!

Parents and teachers should report hazardous conditions in schools on the Healthy Schools app.

Scan here to  
download the app:



### School Districts of Philadelphia Asbestos Reports:



AHERA Reports are documents generated from EPA required asbestos inspections

### Office of the Controller Asbestos Project:



Asbestos abatement notification forms

## Questions?

Find more resources on our website!

- Photo gallery of different types of damaged asbestos containing materials
- Guide to how we classify materials in schools
- Our analysis and reporting methodology
- What we do with the information in this report

[prcceh.upenn.edu/asbestos](http://prcceh.upenn.edu/asbestos)



Email us at [prcceh@penntestmed.upenn.edu](mailto:prcceh@penntestmed.upenn.edu) or call 215-573-9076

Table 1: Friable Asbestos Containing Materials Identified

**NOTE:** Friable materials can be reduced to a powder by applying hand pressure.  
***Do not touch it!*** Damaged and significantly damaged friable materials readily release harmful asbestos fibers into the air.

Location	Material Name	Reported as Damaged or Significantly Damaged? (Blank = No)	Abatement scheduled since the inspection? (Blank = No)
Fan Room (Upper Level) in Gymnasium	Fireproofing		
Auditorium Stage	Fireproofing		
Custodial Closet next to Elevator	Pipe Fitting Insulation associated with Fiberglass Pipe Insulation		
Building Exterior	Caulk associated with Door, Exterior		
Building Exterior	Caulk associated with Louver		
Building Exterior	Caulk associated with Vent		
Roof	Caulk associated with Mushroom Vent		
Fan Room (Upper Level) in Gymnasium	Fireproofing		
Auditorium Stage	Fireproofing		
Custodial Closet next to Elevator	Pipe Fitting Insulation associated with Fiberglass Pipe Insulation		
Building Exterior	Caulk associated with Door, Exterior		
Building Exterior	Caulk associated with Louver		
Building Exterior	Caulk associated with Vent		
Roof	Caulk associated with Mushroom Vent		
Fan Room (Upper Level) in Gymnasium	Fireproofing		
Auditorium Stage	Fireproofing		

Table 2: Non-Friable Asbestos Containing Materials Identified

**NOTE: Significantly Damaged non-friable materials (damage  $\geq$  10% of the material) can release harmful asbestos fibers into the air.**

Location	Material Name	Reported as Damaged or Significantly Damaged? (Blank = No)	Abatement scheduled since the inspection? (Blank = No)
Classroom 100	Transite associated with Fuse Box		
Classroom 100	ACM Unit Ventilator		
Classroom 100	Mastic associated with Floor Tile		
Classroom 100	Floor Tile VAT 12" x 12"		
Classroom 100	Expansion Seam Caulking		
Classroom 100 Restroom	Mastic associated with Floor Tile		
Classroom 100 Restroom	Floor Tile VAT 12" x 12"		
Classroom 100 Coat Room	Mastic associated with Floor Tile		
Classroom 100 Coat Room	Floor Tile VAT 12" x 12"		
Classroom 100 Storage Closet	Mastic associated with Floor Tile		
Classroom 100 Storage Closet	Floor Tile VAT 12" x 12"		
Classroom 101	Mastic associated with Floor Tile		
Classroom 101	Transite associated with Fuse Box		
Classroom 101	ACM Unit Ventilator		
Classroom 101	Floor Tile VAT 12" x 12"		
Classroom 101 Restroom	Mastic associated with Floor Tile		
Classroom 101 Restroom	Floor Tile VAT 12" x 12"		
Classroom 101 Coat Room	Mastic associated with Floor Tile		
Classroom 101 Coat Room	Floor Tile VAT 12" x 12"		
Classroom 101 Storage Closet	Mastic associated with Floor Tile		
Classroom 101 Storage Closet	Floor Tile VAT 12" x 12"		
Girl's Restroom across from Nurse's Office	Expansion Seam Caulking		
Storeroom across from Nurse's Office	Mastic associated with Floor Tile		
Storeroom across from Nurse's Office	Floor Tile VAT 9" x 9"		
Custodial Closet across from Main Office	Mastic associated with Floor Tile		
Custodial Closet across from Main Office	Floor Tile VAT 9" x 9"		
Counselor's Office	Mastic associated with Floor Tile		
Counselor's Office	Transite associated with Fuse Box		
Counselor's Office	ACM Unit Ventilator		
Counselor's Office	Floor Tile VAT 9" x 9"		
Counselor's Office Large Closet	Mastic associated with Floor Tile		
Counselor's Office Large Closet	Floor Tile VAT 9" x 9"		
Counselor's Office Small Closet	Mastic associated with Floor Tile		
Counselor's Office Small Closet	Floor Tile VAT 9" x 9"		
Nurse's Office	Mastic associated with Floor Tile		
Nurse's Office	Floor Tile VAT 9" x 9"		
Nurse's Office Restroom	Mastic associated with Floor Tile		
Nurse's Office Restroom	Floor Tile VAT 9" x 9"		
Nurse's Office Closet	Mastic associated with Floor Tile		
Nurse's Office Closet	Floor Tile VAT 9" x 9"		

# Robert Morris School: Asbestos Hazard Report

Main Office - Office across from Security Room	Mastic associated with Floor Tile		
Main Office - Office across from Security Room	Floor Tile VAT 9" x 9"		
Main Office - Office across from mail boxes	Mastic associated with Floor Tile		
Main Office - Office across from mail boxes	Floor Tile VAT 9" x 9"		
Main Office Security Room	Mastic associated with Floor Tile		
Main Office Security Room	Floor Tile VAT 9" x 9"		
Main Office	Mastic associated with Floor Tile		
Main Office	Transite associated with Fuse Box		
Main Office	ACM Unit Ventilator		
Main Office	Floor Tile VAT 9" x 9"	Damaged.	Removal scheduled for Aug – Nov 2025.
Principal's Office	Floor Tile VAT 9" x 9"	Damaged. Previously reported damaged in Jan 2025 and was still damaged in Jul 2025.	
Principal's Office	Floor Tile VAT 12" x 12"		
Principal's Office Restroom	Mastic associated with Floor Tile		
Principal's Office Restroom	Floor Tile VAT 12" x 12"		
Principal's Office Closet	Mastic associated with Floor Tile		
Principal's Office Closet	Floor Tile VAT 12" x 12"		
Main Office Closet	Mastic associated with Floor Tile		
Main Office Closet	Floor Tile VAT 9" x 9"		
Auditorium	Mastic associated with Floor Tile		
Auditorium	Floor Tile VAT 12" x 12"		
Auditorium	Floor Tile VAT 9" x 9"		
Stage Storage Room	Mastic associated with Floor Tile		
Stage Storage Room	Floor Tile VAT 9" x 9"		
Auditorium Closet	Mastic associated with Floor Tile		
Auditorium Closet	Floor Tile VAT 9" x 9"		
Gym	Mastic associated with Floor Tile		
Gym	Floor Tile VAT 12" x 12"		
Gym Storeroom (Former Kitchen)	Mastic associated with Floor Tile		
Gym Storeroom (Former Kitchen)	Floor Tile VAT 9" x 9"		
Gym Storeroom (Former Kitchen)	Sink Undercoat Mastic		
Gym Office	Mastic associated with Floor Tile		
Gym Office	Floor Tile VAT 12" x 12"		
Gym Office Restroom	Mastic associated with Floor Tile		
Gym Office Restroom	Floor Tile VAT 12" x 12"		
Gym Equipment Storeroom	Floor Tile VAT 12" x 12"		
Gym Storeroom (former Girl's Coatroom)	Mastic associated with Floor Tile		
Gym Storeroom (former Girl's Coatroom)	Floor Tile VAT 12" x 12"		
Gym Storeroom (former Boy's Restroom)	Mastic associated with Floor Tile		
Gym Storeroom (former Boy's Restroom)	Floor Tile VAT 12" x 12"		
Gym Boy's Restroom	Transite associated with Gang Urinal Chase Lid		
Elevator	Mastic associated with Floor Tile		
Elevator	Floor Tile VAT 12" x 12"		
Hallway from Stairwell across from Main Office to Gym	Mastic associated with Floor Tile		
Hallway from Stairwell across from Main Office to Gym	Floor Tile VAT 12" x 12"		

# Robert Morris School: Asbestos Hazard Report

Hallway from Stairwell across from Main Office to Gym	Floor Tile VAT 12" x 12"		
Hallway from Stairwell across from Main Office to Gym	Floor Tile VAT 12" x 12"		
Hallway from Main Lobby to Classroom 100	Mastic associated with Floor Tile		
Hallway from Main Lobby to Classroom 100	Floor Tile VAT 9" x 9"		
Pipe Chase in Girl's Restroom next to yard door	Transite associated with Ceiling		
Pipe Chase in Gym Boy's Restroom	Transite associated with Ceiling		
Stairwell #2 across from Main Office	Mastic associated with Floor Tile		
Stairwell #2 across from Main Office	Floor Tile VAT 12" x 12"		
Stairwell #2 across from Main Office	Floor Tile VAT 12" x 12"		
Stairwell #1 across from Classroom 100	Expansion Seam Caulking		
Stairwell #3 off Hallway from Stairwell across from Main Office to Gym	Mastic associated with Floor Tile		
Stairwell #3 off Hallway from Stairwell across from Main Office to Gym	Floor Tile VAT 12" x 12"		
Stairwell #3 off Hallway from Stairwell across from Main Office to Gym	Floor Tile VAT 12" x 12"		
Auditorium Stage	Mastic associated with Floor Tile		
Auditorium Stage	Floor Tile VAT 9" x 9"		
Classroom 200	Mastic associated with Floor Tile		
Classroom 200	Transite associated with Fuse Box		
Classroom 200	ACM Unit Ventilator		
Classroom 200	Glue Dots associated with Blackboard		
Classroom 200	Floor Tile VAT 12" x 12"		
Classroom 201	Mastic associated with Floor Tile		
Classroom 201	Transite associated with Fuse Box		
Classroom 201	ACM Unit Ventilator		
Classroom 201	Glue Dots associated with Blackboard		
Classroom 201	Floor Tile VAT 9" x 9"		
Classroom 202	Mastic associated with Floor Tile		
Classroom 202	Transite associated with Fuse Box		
Classroom 202	ACM Unit Ventilator		
Classroom 202	Glue Dots associated with Blackboard		
Classroom 202	Floor Tile VAT 9" x 9"		
Classroom 203	Mastic associated with Floor Tile		
Classroom 203	Transite associated with Fuse Box		
Classroom 203	ACM Unit Ventilator		
Classroom 203	Glue Dots associated with Blackboard		
Classroom 203	Floor Tile VAT 12" x 12"		
Classroom 204	Mastic associated with Floor Tile		
Classroom 204	Transite associated with Fuse Box		
Classroom 204	ACM Unit Ventilator		
Classroom 204	Glue Dots associated with Blackboard		
Classroom 204	Floor Tile VAT 12" x 12"		
Classroom 206	Mastic associated with Floor Tile		
Classroom 206	Transite associated with Fuse Box		
Classroom 206	ACM Unit Ventilator		
Classroom 206	Glue Dots associated with Blackboard		
Classroom 206	Floor Tile VAT 9" x 9"		
Classroom 208	Mastic associated with Floor Tile		
Classroom 208	Transite associated with Fuse Box		
Classroom 208	ACM Unit Ventilator		



# Robert Morris School: Asbestos Hazard Report

Classroom 208	Glue Dots associated with Blackboard		
Classroom 208	Floor Tile VAT 9" x 9"		
Cafeteria (210)	Mastic associated with Floor Tile		
Cafeteria (210)	Transite associated with Fuse Box		
Cafeteria (210)	ACM Unit Ventilator		
Cafeteria (210)	Glue Dots associated with Blackboard		
Cafeteria (210)	Floor Tile VAT 9" x 9"		
Cafeteria (212)	Mastic associated with Floor Tile		
Cafeteria (212)	Transite associated with Fuse Box		
Cafeteria (212)	ACM Unit Ventilator		
Cafeteria (212)	Glue Dots associated with Blackboard		
Cafeteria (212)	Floor Tile VAT 9" x 9"		
Classroom 213	Transite associated with Fuse Box		
Classroom 213	ACM Unit Ventilator		
Classroom 213	Glue Dots associated with Blackboard		
Classroom 214	Mastic associated with Floor Tile		
Classroom 214	Transite associated with Fuse Box		
Classroom 214	ACM Unit Ventilator		
Classroom 214	Glue Dots associated with Blackboard		
Classroom 214	Floor Tile VAT 9" x 9"		
Classroom 215	Mastic associated with Floor Tile		
Classroom 215	Transite associated with Fuse Box		
Classroom 215	ACM Unit Ventilator		
Classroom 215	Glue Dots associated with Blackboard		
Classroom 215	Floor Tile VAT 9" x 9"		
Classroom 216	Mastic associated with Floor Tile		
Classroom 216	Transite associated with Fuse Box		
Classroom 216	ACM Unit Ventilator		
Classroom 216	Glue Dots associated with Blackboard		
Classroom 216	Floor Tile VAT 12" x 12"		
Office 217	Mastic associated with Floor Tile		
Office 217	Transite associated with Fuse Box		
Office 217	ACM Unit Ventilator		
Office 217	Glue Dots associated with Blackboard		
Office 217	Floor Tile VAT 9" x 9"		
Classroom 218	Mastic associated with Floor Tile		
Classroom 218	Transite associated with Fuse Box		
Classroom 218	ACM Unit Ventilator		
Classroom 218	Glue Dots associated with Blackboard		
Classroom 218	Floor Tile VAT 12" x 12"		
Storeroom next Classroom 218	Mastic associated with Floor Tile		
Storeroom next Classroom 218	Floor Tile VAT 9" x 9"		
Women's Restroom by Classroom 218	Mastic associated with Floor Tile		
Women's Restroom by Classroom 218	Floor Tile VAT 12" x 12"		
Kitchen 219	Mastic associated with Floor Tile		
Kitchen 219	Transite associated with Fuse Box		
Kitchen 219	ACM Unit Ventilator		
Kitchen 219	Glue Dots associated with Blackboard		
Kitchen 219	Floor Tile VAT 12" x 12"		
Kitchen 219	Floor Tile VAT 9" x 9"		
Kitchen Storeroom	Mastic associated with Floor Tile		
Kitchen Storeroom	Floor Tile VAT 12" x 12"		
Boy's Restroom	Heat Shield Insulation associated with Radiator		
Girl's Restroom	Heat Shield Insulation associated with Radiator		
Women's Restroom across from Classroom 204	Heat Shield Insulation associated with Radiator		



# Robert Morris School: Asbestos Hazard Report

Storeroom next to Men's Restroom	Mastic associated with Floor Tile		
Storeroom next to Men's Restroom	Floor Tile VAT 9" x 9"		
Computer Server Room in Storeroom next to Men's Restroom	Mastic associated with Floor Tile		
Computer Server Room in Storeroom next to Men's Restroom	Floor Tile VAT 9" x 9"		
Custodial Closet next to Elevator	Mastic associated with Floor Tile		
Custodial Closet next to Elevator	Floor Tile VAT 9" x 9"		
Hallway from Lunch Room to Classroom 200	Mastic associated with Floor Tile		
Hallway from Lunch Room to Classroom 200	Heat Shield Insulation associated with Radiator		
Hallway from Lunch Room to Classroom 200	Floor Tile VAT 9" x 9"		
Hallway from Classroom 208 to 218	Mastic associated with Floor Tile		
Hallway from Classroom 208 to 218	Floor Tile VAT 9" x 9"		
Stairwell #2 across from Classroom 206	Heat Shield Insulation associated with Radiator		
Stairwell #3 next to Classroom 215	Heat Shield Insulation associated with Radiator		
Stairwell #1 next to Classroom 201	Heat Shield Insulation associated with Radiator		
Classroom 300	Mastic associated with Floor Tile		
Classroom 300	Transite associated with Fuse Box		
Classroom 300	ACM Unit Ventilator		
Classroom 300	Floor Tile VAT 12" x 12"		
Classroom 300	Glue Dots associated with Blackboard		
Classroom 300	Floor Tile VAT 9" x 9"		
Classroom 301	Mastic associated with Floor Tile		
Classroom 301	Transite associated with Fuse Box		
Classroom 301	ACM Unit Ventilator		
Classroom 301	Glue Dots associated with Blackboard		
Classroom 301	Floor Tile VAT 9" x 9"		
Classroom 302	Mastic associated with Floor Tile		
Classroom 302	Transite associated with Fuse Box		
Classroom 302	ACM Unit Ventilator		
Classroom 302	Glue Dots associated with Blackboard		
Classroom 302	Floor Tile VAT 9" x 9"		
Classroom 303	Mastic associated with Floor Tile		
Classroom 303	Transite associated with Fuse Box		
Classroom 303	ACM Unit Ventilator		
Classroom 303	Glue Dots associated with Blackboard		
Classroom 303	Floor Tile VAT 9" x 9"		
Classroom 304	Mastic associated with Floor Tile		
Classroom 304	Transite associated with Fuse Box		
Classroom 304	ACM Unit Ventilator		
Classroom 304	Glue Dots associated with Blackboard		
Classroom 304	Floor Tile VAT 9" x 9"	Damaged.	Removal scheduled for Aug – Nov 2025.
Classroom 306	Mastic associated with Floor Tile		
Classroom 306	Transite associated with Fuse Box		
Classroom 306	ACM Unit Ventilator		
Classroom 306	Glue Dots associated with Blackboard		
Classroom 306	Floor Tile VAT 9" x 9"		
Classroom 308	Mastic associated with Floor Tile		
Classroom 308	Transite associated with Fuse Box		
Classroom 308	ACM Unit Ventilator		
Classroom 308	Glue Dots associated with Blackboard		

# Robert Morris School: Asbestos Hazard Report

Classroom 308	Floor Tile VAT 9" x 9"		
Classroom 313	Mastic associated with Floor Tile		
Classroom 313	Transite associated with Fuse Box		
Classroom 313	ACM Unit Ventilator		
Classroom 313	Glue Dots associated with Blackboard		
Classroom 313	Floor Tile VAT 9" x 9"		
Library (310, 312, & 314)	Transite associated with Fuse Box		
Library (310, 312, & 314)	ACM Unit Ventilator		
Classroom 315	Mastic associated with Floor Tile		
Classroom 315	Transite associated with Fuse Box		
Classroom 315	Glue Dots associated with Blackboard		
Classroom 315	ACM Unit Ventilator		
Classroom 315	Floor Tile VAT 9" x 9"		
Classroom 316	Mastic associated with Floor Tile		
Classroom 316	Transite associated with Fuse Box		
Classroom 316	ACM Unit Ventilator		
Classroom 316	Floor Tile VAT 12" x 12"		
Classroom 317	Mastic associated with Floor Tile		
Classroom 317	Transite associated with Fuse Box		
Classroom 317	ACM Unit Ventilator		
Classroom 317	Glue Dots associated with Blackboard		
Classroom 317	Floor Tile VAT 9" x 9"		
Classroom 318	Mastic associated with Floor Tile		
Classroom 318	Transite associated with Fuse Box		
Classroom 318	ACM Unit Ventilator		
Classroom 318	Glue Dots associated with Blackboard		
Classroom 318	Floor Tile VAT 9" x 9"		
Classroom 318 Closet	Mastic associated with Floor Tile		
Classroom 318 Closet	Floor Tile VAT 9" x 9"		
Storage Room next to Classroom 318	Mastic associated with Floor Tile		
Storage Room next to Classroom 318	Floor Tile VAT 9" x 9"		
Classroom 319	Mastic associated with Floor Tile		
Classroom 319	Transite associated with Fuse Box		
Classroom 319	Sink Undercoat Mastic		
Classroom 319	ACM Unit Ventilator		
Classroom 319	Glue Dots associated with Blackboard		
Classroom 319	Floor Tile VAT 9" x 9"		
Classroom 319 Closet	Mastic associated with Floor Tile		
Classroom 319 Closet	Floor Tile VAT 9" x 9"		
Boy's Restroom	Heat Shield Insulation associated with Radiator		
Girl's Restroom	Heat Shield Insulation associated with Radiator		
Women's Restroom	Heat Shield Insulation associated with Radiator		
Storeroom next to Men's Restroom	Mastic associated with Floor Tile		
Storeroom next to Men's Restroom	Floor Tile VAT 9" x 9"		
Custodial Closet next to Elevator	Mastic associated with Floor Tile		
Custodial Closet next to Elevator	Floor Tile VAT 9" x 9"		
Hallway from Classroom 308 to 318	Mastic associated with Floor Tile		
Hallway from Classroom 308 to 318	Floor Tile VAT 9" x 9"		
Hallway from Library to Classroom 300	Mastic associated with Floor Tile		
Hallway from Library to Classroom 300	Heat Shield Insulation associated with Radiator		
Hallway from Library to Classroom 300	Floor Tile VAT 9" x 9"		
Stairwell #2 next to Elevator	Heat Shield Insulation associated with Radiator		
Stairwell #1 next to Classroom 301	Heat Shield Insulation associated with Radiator		
Stairwell #3 next to Classroom 315	Heat Shield Insulation associated with Radiator		
Classroom 400	Mastic associated with Floor Tile		
Classroom 400	Transite associated with Fuse Box		

# Robert Morris School: Asbestos Hazard Report

Classroom 400	ACM Unit Ventilator		
Classroom 400	Floor Tile VAT 12" x 12"		
Classroom 400	Glue Dots associated with Blackboard		
Classroom 401	Mastic associated with Floor Tile		
Classroom 401	Transite associated with Fuse Box		
Classroom 401	Floor Tile VAT 12" x 12"		
Classroom 401	ACM Unit Ventilator		
Classroom 401	Glue Dots associated with Blackboard		
Classroom 402	Mastic associated with Floor Tile		
Classroom 402	Transite associated with Fuse Box		
Classroom 402	ACM Unit Ventilator		
Classroom 402	Glue Dots associated with Blackboard		
Classroom 402	Floor Tile VAT 9" x 9"		
Classroom 403	Mastic associated with Floor Tile		
Classroom 403	Transite associated with Fuse Box		
Classroom 403	ACM Unit Ventilator		
Classroom 403	Glue Dots associated with Blackboard		
Classroom 403	Floor Tile VAT 12" x 12"		
Classroom 404	Mastic associated with Floor Tile		
Classroom 404	Transite associated with Fuse Box		
Classroom 404	ACM Unit Ventilator		
Classroom 404	Glue Dots associated with Blackboard		
Classroom 404	Floor Tile VAT 9" x 9"		
Classroom 406	Mastic associated with Floor Tile		
Classroom 406	Transite associated with Fuse Box		
Classroom 406	ACM Unit Ventilator		
Classroom 406	Glue Dots associated with Blackboard		
Classroom 406	Floor Tile VAT 9" x 9"		
Classroom 408	Mastic associated with Floor Tile		
Classroom 408	Transite associated with Fuse Box		
Classroom 408	Floor Tile VAT 12" x 12"		
Classroom 408	ACM Unit Ventilator		
Classroom 408	Glue Dots associated with Blackboard		
Classroom 408	Floor Tile VAT 9" x 9"		
Cafeteria (410)	Mastic associated with Floor Tile		
Cafeteria (410)	Transite associated with Fuse Box		
Cafeteria (410)	ACM Unit Ventilator		
Cafeteria (410)	Glue Dots associated with Blackboard		
Cafeteria (410)	Floor Tile VAT 9" x 9"		
Cafeteria (412)	Mastic associated with Floor Tile		
Cafeteria (412)	Transite associated with Fuse Box		
Cafeteria (412)	ACM Unit Ventilator		
Cafeteria (412)	Glue Dots associated with Blackboard		
Cafeteria (412)	Floor Tile VAT 9" x 9"		
Custodial Storeroom 413	Mastic associated with Floor Tile		
Custodial Storeroom 413	Transite associated with Fuse Box		
Custodial Storeroom 413	ACM Unit Ventilator		
Custodial Storeroom 413	Glue Dots associated with Blackboard		
Custodial Storeroom 413	Floor Tile VAT 9" x 9"		
Classroom 414	Mastic associated with Floor Tile		
Classroom 414	Transite associated with Fuse Box		
Classroom 414	ACM Unit Ventilator		
Classroom 414	Glue Dots associated with Blackboard		
Classroom 414	Floor Tile VAT 9" x 9"		
Classroom 415	Mastic associated with Floor Tile		
Classroom 415	Transite associated with Fuse Box		

# Robert Morris School: Asbestos Hazard Report

Classroom 415	ACM Unit Ventilator		
Classroom 415	Glue Dots associated with Blackboard		
Classroom 415	Floor Tile VAT 9" x 9"		
Classroom 416	Mastic associated with Floor Tile		
Classroom 416	Transite associated with Fuse Box		
Classroom 416	ACM Unit Ventilator		
Classroom 416	Floor Tile VAT 12" x 12"		
Staff Lounge 417	Mastic associated with Floor Tile		
Staff Lounge 417	Transite associated with Fuse Box		
Staff Lounge 417	ACM Unit Ventilator		
Staff Lounge 417	Glue Dots associated with Blackboard		
Staff Lounge 417	Floor Tile VAT 9" x 9"		
Classroom 418	Mastic associated with Floor Tile		
Classroom 418	Transite associated with Fuse Box		
Classroom 418	ACM Unit Ventilator		
Classroom 418	Floor Tile VAT 12" x 12"		
Classroom 419	Mastic associated with Floor Tile		
Classroom 419	Transite associated with Fuse Box		
Classroom 419	ACM Unit Ventilator		
Classroom 419	Glue Dots associated with Blackboard		
Classroom 419	Floor Tile VAT 9" x 9"		
Storeroom next to Classroom 419	Mastic associated with Floor Tile		
Storeroom next to Classroom 419	Floor Tile VAT 9" x 9"		
Boy's Restroom across from Classroom 404	Heat Shield Insulation associated with Radiator		
Girl's Restroom across from Classroom 404	Heat Shield Insulation associated with Radiator		
Women's Restroom across from Classroom 406	Heat Shield Insulation associated with Radiator		
Storage next to Men's Restroom	Mastic associated with Floor Tile		
Storage next to Men's Restroom	Floor Tile VAT 9" x 9"		
Storeroom next to Staff Lounge 417	Mastic associated with Floor Tile		
Storeroom next to Staff Lounge 417	Floor Tile VAT 9" x 9"		
Custodial Closet next to Elevator	Mastic associated with Floor Tile		
Custodial Closet next to Elevator	Floor Tile VAT 12" x 12"		
Hallway from Classroom 408 to 419	Mastic associated with Floor Tile		
Hallway from Classroom 408 to 419	Heat Shield Insulation associated with Radiator		
Hallway from Classroom 408 to 419	Floor Tile VAT 9" x 9"		
Hallway from Custodial Closet to Classroom 400	Mastic associated with Floor Tile		
Hallway from Custodial Closet to Classroom 400	Floor Tile VAT 12" x 12"		
Hallway from Custodial Closet to Classroom 400	Heat Shield Insulation associated with Radiator		
Hallway from Custodial Closet to Classroom 400	Floor Tile VAT 9" x 9"		
Stairwell next to Classroom 401	Heat Shield Insulation associated with Radiator		
Stairwell #3 next to Classroom 415	Heat Shield Insulation associated with Radiator		
Building Engineer's Restroom	Mastic associated with Floor Tile		
Building Engineer's Restroom	Floor Tile VAT 12" x 12"		
Building Exterior	Mortar associated with Wall, Concrete		